
ニューハイパワー ミーリングチャック 12J

取扱説明書

ご使用前に必ず本書をお読みいただき、ご使用される方がいつでも見ることができる場所に必ず保管してください。

本体仕様

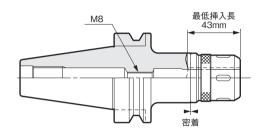

※工具シャンクは、最低挿入長以上に 挿入してください。

- 🛕 ご注意

---ジェットスルー使用時の注意

・工具が内径の底に当たっているとクーラントが出ませんので、 1mm以上の隙間をあけてください。






工具の取り付け・取り外し方

《締め付け》

スパナ(別売)でナットを矢印の方向に回し て締め付けてください。


※ナット端面がチャック本体の端面に密着するところまで締め付けてください。密着時に勢いよくナットを締め付けると緩みにくくなる場合がありますのでご注意ください。

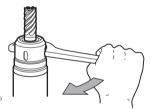

《取り外し》

矢印の方向にナットが完 全に緩むまで回してエ 具を抜き取ってください。

フックスパナ型式(別売) FK31-33

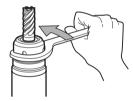



⚠ で注意 ----

工具の取り付け時の注意

- ・ナットをチャック本体に密着させる時には、密着部のナット、チャック本体の端面を清掃してください。振れ精度に 影響します。
- ・工具シャンクはh7公差内のものをご使用ください。
- ・チャック内径、コレットの内外径、工具シャンク部についた傷や溶着物、切りくずは取り除き、汚れは脱脂剤を使ってウエスで拭き取ってください。
- ・工具シャンク部に切欠きのあるサイドロックのものは使用しないでください。振れ精度や把握力の低下、動バランス精度 劣化、チャック本体の損傷の原因となり 得る場合があります。



加工中の注意

- ・大きな振動を伴った加工(びびり加工)は続けないでください。
- ・回転中のチャックや工具は大変危険ですので触れないでください。
- ・許容回転速度が刻印されている製品につきまして、安全のため許容回転速度以下でご使用ください。ただし、L/D=5を超える長い工具やアンバランスの大きい工具を取り付ける場合は、さらに回転速度を下げてご使用ください。

工具の取り外し時の注意

- ・工具を抜き取った後に、もう1回転以上ナットを緩めてください。この作業を怠ると完全に締め付ける事ができず、加工中に工具が抜ける恐れがあります。
- ・ナットの締め付け、緩めるときには勢い余ってフックス パナがナットから外れて工具で怪我をしないよう十分に 気をつけて作業を行うようにしてください。

その他の注意

- ・チャックは空締めしないでください。
- ・プルボルトは (**別仮**) 製のものをご使用いただき、2年毎に 交換してください。
- ・プルボルトは頭部に打痕傷や、胴部に曲がりのあるものは 使用しないでください。

ストレートコレットご使用時の注意

ストレートコレットが取り外しにくい場合、コレットフック(別売)をご使用ください。

コレットフック型式(別売) SCH



NEW Hi-POWER MILLING CHUCK 12J

OPERATION MANUAL


Please read these instructions before use and keep them where the operator may refer to them whenever necessary.

OPERATION MANUAL DOWNLOAD SITE

https://big-daishowa.com/manual_index.php



SPECIFICATIONS

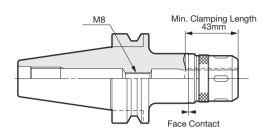

**The length of the cutting tool shank which is inserted into the chuck must be longer than the min. clamping length.


CAUTION for "JET-THROUGH" coolant to tool periphery For use of Jet-through type with coolant, always leave 1 mm or more gap between the end of cutting tool shank and the bottom of the chuck bore. Failure to do so blocks flow of coolant. Max.tool insertion length 64mm Body Coolant Cutting Tool Gap

TO ASSEMBLE AND REMOVE THE CUTTING TOOL

(ASSEMBLY)

Using the C-Spanner, tighten the nut in the direction of the arrow to the appropriate clamping position.

**Tighten the nut until achieves close contact with the body. Tightening the nut forcefully during close contact may cause difficulty of loosen the nut.

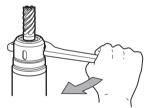

《REMOVAL OF TOOL》


Without gap

Release the nut sufficiently in the direction of the arrow. Then remove the cutting tool.

C-Spanner Model (Optional) FK31-33

REMOVING THE CUTTING TOOL

assembling/releasing operation.

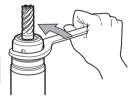

With gap



CAUTION ---

ASSEMBLY OF THE CUTTING TOOL in the NEW Hi-POWER MILLING CHUCK

- For heavier duty machining setup, clean the contact faces of both the Nut and Body. Neglecting to do so could affect runout accuracy.
- · Use a shank of cutting tool with the tolerance within h7.
- Remove scratches, adhesions, chips on the chuck bore, the external and internal diameters of the collet, and contamination on them with a waste cloth using a degreaser.
- DO NOT USE the side-lock type of cutting tool which has notches on the shank.

OTHERS • NEVER C

NEVER clamp the nut without a cutting tool being inserted.

disengagement of the C-Spanner from the Nut in

• (BIG) recommend our own make of pullstud to be compatible with the NEW Hi-POWER MILLING CHUCK. It should be replaced every two years.

 Always release the nut at least a further revolution after removing the cutting tool. Failure to do so could result in reduced gripping force

on the subsequent tightening and possible failure during cutting.

Care should be taken to avoid injury on the cutting edges at possible

 DO NOT USE any pullstud which has damage marks to its draw head area or is deformed.

DURING OPERATION

- DO NOT continue if vibration / chatter is experienced.
- DO NOT touch the chuck or cutting tool while the spindle is revolving.
- Allowable max. spindle speed is marked on some products. NEVER exceed the designated speed for safety.
 Ensure to further lower the speed when used with a tool having longer projection than L/D=5 or excessive imbalance.

For use of Straight Collet

In case Straight Collet is hard to detach from the chuck, use the COLLET HOOK (Optional).

Collet Hook Model (Optional) SCH

